

# **Tollaust Pty Ltd**

# **Lane Cove Tunnel**

CO In Tunnel Air Quality Monitoring Validated Report

# 1<sup>st</sup> September 2018 – 30<sup>th</sup> September 2018

Report No.: DAT13724

Report issue date: 05/10/2018

Maintenance contract: MC1072

ECOTECH PTY LTD. ABN: 32005752081

1492 Ferntree Gully Rd, Knoxfield VIC. 3180. AUSTRALIA

Tel No: 1300 364 946 Fax No: 1300 668 763

 ${\it Email} \ \ \underline{\it ecotech@ecotech.com} \ \ \ {\it WEB www.ecotech.com}$ 

This document shall not be reproduced except for in full, without the written approval of Ecotech Pty Ltd.

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

Customer Details					
Customer Tollaust Pty Ltd					
Contact name	e Craig Watson				
Address	5 Sirius Road, Lane Cove West, NSW 2066				
Email	cwatson@transurban.com				
Phone	(02) 9937 1240				

Revision History				
Revision	Report ID	Date	Analyst	
0	DAT13724	05/10/2018	Amanda Hudson	

Report by:

Amanda Hudson

**Approved Signatory:** 

Jon Alexander

# **Report No: DAT13724**

**Tollaust Pty Ltd** 

## **Table of Contents**

С	ustomer [	Details	2
R	evision Hi	story	2
T	able of Co	ntents	3
Li	st of Figu	res	4
Li	st of Table	es	4
Exe	cutive Sun	nmary	5
1.0	Introd	uction	6
2.0	Monit	oring and Data Collection	6
2	.1. Siting [	Details	6
2	.2 .Monit	ored Parameters	9
2	.3. Data C	ollection Methods	10
	2.3.1.	Compliance with Standards	10
	2.3.2.	Data Acquisition	10
	2.3.3.	Data Validation	11
	2.3.4.	Reporting	11
3.0	Air Qu	ality Goals	12
4.0	Calibra	ations and Maintenance	13
4	.1.Units aı	nd Uncertainties	13
5.0	Result	S	14
5	.1. Data C	apture	14
5	.2. Air Qua	ality Summary	16
5	.3. Graphi	c Representations	17
Rep	ort Summ	nary	20
Ann	endix 1 - I	Definitions & Abbreviations	21

# **Report No: DAT13724**

List of Figures Figure 1: Lane Cove monitoring network	8
Figure 2: CO exposure and single point 3 minutes rolling averages for September 2018	. 17
Figure 3: CO exposure and single point 15 minutes rolling averages for September 2018	. 17
Figure 4: CO exposure and single point 30 minutes rolling averages for September 2018	. 18
Figure 5: CO exposure and single point 3 minutes rolling averages from July 2018 to September 2018 (3 monthly trend)	
Figure 6: CO exposure and single point 15 minutes rolling averages from July 2018 to September 2018 (monthly trend)	-
Figure 7: CO exposure and single point 30 minutes rolling averages from July 2018 to September 2018 (monthly trend)	•
List of Tables	
Table 1: Locations and parameters for In-tunnel open path type air quality monitoring	7
Table 2: Parameters measured at the Lane Cove monitoring network	9
Table 3: Methods	. 10
Table 4: Station/Network Air Quality Goals	. 12
Table 5: Units and Uncertainties	. 13
Table 6: Monthly Data Capture for Lane Cove Tunnel & Military Road E-Ramp monitors for September 2018	. 15
Table 7: Exceedences Recorded for September 2018	. 16

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

## **Executive Summary**

The Lane Cove Tunnel is located in Sydney, Australia and is a 3.6 km twin tunnel motorway under Epping Road that links the M2 Motorway at North Ryde with the Gore Hill Freeway at Artarmon. Ecotech Pty Ltd is contracted by Tollaust Pty Ltd to undertake reporting services for the air quality monitoring system inside the tunnel which ensures that the carbon monoxide (CO) levels inside the Tunnel are always kept to within levels and limits stipulated by the Ministers Conditions of Approval (MCoA) for the Lane Cove Tunnel.

Continuous measurements of CO inside the tunnel are recorded, validated and reported to Tollaust Pty Ltd on a monthly basis.

Maintenance and calibrations are performed by a third party contractor.

This report presents validated data for the month of September 2018.

During the reporting period of September 2018, there were no observed exceedences of CO limits stipulated by the Department of Planning inside the tunnel.

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

#### 1.0 Introduction

Ecotech is an independent company contracted by Tollaust Pty Ltd to undertake in tunnel air quality reporting at the Lane Cove Tunnel.

This report presents the validated data for September 2018.

- Describes air quality measurements;
- Reports any readings above the LCT limits;
- Compares monitoring results;
- Has been quality assured;

## 2.0 Monitoring and Data Collection

#### **2.1.** Siting Details

The CO In tunnel monitoring network consists of

• Twenty eight separate CO monitors attached to the walls and portals of both eastbound and westbound tunnels

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

Table 1: Locations and parameters for In-tunnel open path type air quality monitoring

	Darameters Measured		
Monitoring Location	Parameters Measured		
World in Eccation	СО		
A	AQS101		
В	AQS501		
С	AQS502		
F	AQS503		
G	ACO101		
Н	AQS504		
I	AQS505		
J	AQS102		
М	ACO102		
N	ACO501		
Q	AQS103		
R	AQS506		
S	ACO103		
Т	ACO502		
U	AQS104		
V	AQS507		
W	ACO401		
X	ACO104		
Υ	AQS401		
Z	AQS402		
AA	AQS105		
AB	ACO801		
AC	AQS403		
AG	AQS106		
АН	ACO503		
Al	AQS801		
AJ	AQS107		
AK	AQS508		
TOTAL	28		

Non-highlighted rows – tunnel wall monitors; light grey highlighted rows – portal located monitors; dark grey highlighted rows –in ventilation stack monitors

**Report No: DAT13724** 

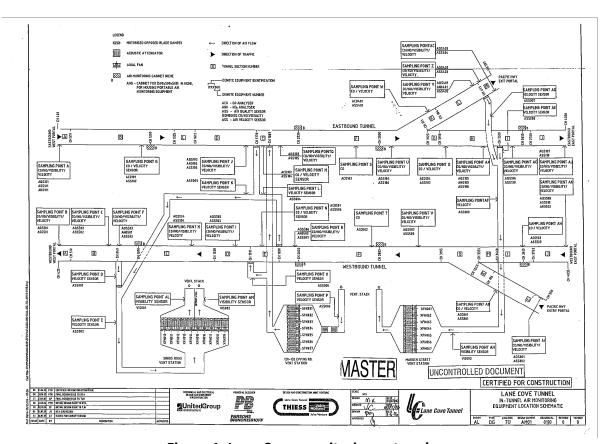


Figure 1: Lane Cove monitoring network

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

## **2.2.** Monitored Parameters

Table 2 below details the parameters monitored and the instruments used at the monitoring network. Appendix 1 defines any abbreviated parameter names used throughout the report.

Table 2: Parameters measured at the Lane Cove monitoring network

Parameter Measured	Instrument and Measurement Technique
со	CODEL TunnelCraft III AQM – Infrared Gas Cell Correlation.

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

#### 2.3. Data Collection Methods

Table 3 below shows the methods used for data collection. Any deviations from the stated methods are detailed in section 2.3.1.

**Table 3: Methods** 

Parameter Measured	Data Collection Methods Used	Description of Method	
СО	Codel Tunnel Master Open Path - infrared	This method involves projecting an infrared beam across a 3 metre section of the tunnel into a reflector and the reflected light is received by a transceiver which measures the specific absorption	

Carbon monoxide (CO) levels are measured inside the tunnel using a network of 28 separate CO monitors attached to the walls of both eastbound and westbound tunnels. The monitors measure CO using an analytical method known as non-dispersive infra-red absorption with gas filter correlation. An infra-red beam is projected across a 3 metre section of the tunnel and the amount of infra-red light absorbed by CO molecules in the path of the beam is measured. The quantity of infra-red light absorbed is proportional to the concentration of CO in the path of the beam. The monitors used were specially designed for use in road tunnels where access for routine essential maintenance is restricted by the need to minimise traffic disruption. Similar monitors are widely used in other road tunnels in Australia and worldwide.

The CO method of analysis is similar to the standard method AM-6 outlined in "NSW EPA 2001, Approved Methods for Sampling and Analysis of Pollutants in New South Wales." However the method differs from the standard principally by the use of the open beam type instrument as described above in place of a closed analytical cell and sample delivery pump as typically used in ambient air monitoring stations. This deviation from the standard method has been approved by the Department of Planning on the advice of an independent consultant with specialist expertise in the field of air quality monitoring.

#### 2.3.1. Compliance with Standards

Unless stated below, parameters are monitored at the Lane Cove Tunnel & Military Road E-Ramp stations according to the methods detailed in Table 3 above.

#### 2.3.2. Data Acquisition

Data acquisition is performed using the LCT-MRE Pty Ltd hardware and software and is supplied to Ecotech on a weekly basis and stored at Ecotech's Environmental Reporting Services (ERS) department in Melbourne, Australia. Data samples are logged in 1 minute intervals.

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

#### 2.3.3. Data Validation

Ecotech ERS maintains two distinct databases containing non-validated and validated data respectively.

The validated database is created by duplicating the non-validated database and then flagging data affected by instrument faults, calibrations and other maintenance activities. The data validation software requires the analyst to supply a valid reason (e.g. backed by maintenance notes, calibration sheets etc) in the database for flagging any data as invalid.

Details of all invalid or missing data are recorded in the Valid Data Exception Tables.

Validation is performed by the analyst, and the validation is reviewed. Graphs and tables are generated based on the validated one minute data.

Validation is based on calibration and maintenance documents provided by Tollaust's appointed contractor at the time of issue.

#### 2.3.4. Reporting

The reported data is in a Microsoft Excel format file named "Data LCT CO In Tunnel September 18 Validated.xls" included as an appendix to this report.

The Excel file consists of 3 Excel worksheets:

- 1. Cover
- 2. Max Single Point 3, 15 and 30 m
- 3. Valid Data Exception Table

The data contained in this report is based on Australian Eastern Standard Time.

All averages are calculated from the one minute data. Averages are based on a minimum of 75% valid readings within the averaging period.

Averaging periods of eight hours or less are reported for the end of the period, i.e. the hourly average 02:00am is for the data collected from 1:00am to 2:00am. One hour averages are calculated based on a clock hour.

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

# 3.0 Air Quality Goals

The air quality goals for pollutants monitored at the Lane Cove Tunnel & Military Road E-Ramp monitors are based on the Ministers Conditions of Approval (MCoA) for the Lane Cove Tunnel. The air quality goals are shown in Table 4 below.

**Table 4: Station/Network Air Quality Goals** 

Parameter	Time Period	Exceedence Level	Units	Applicable MCoA
СО	30 minutes rolling averages	50	ppm	MCoA 160
	15 minutes rolling averages	87	ppm	MCoA 160
	3 minutes rolling averages	200	ppm	MCoA 161

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

## 4.0 Calibrations and Maintenance

### **4.1.** Units and Uncertainties

The uncertainties for each parameter have been determined by the manufacturer's tolerance limits of the equipment's parameters, and by the data collection standard method.

The reported uncertainties are expanded uncertainties, calculated using coverage factors which give a level of confidence of approximately 95%.

**Table 5: Units and Uncertainties** 

Parameter	Units	Resolution	Uncertainty	Measurement Range
СО	ppm	0.1 ppm	± 1.0 ppm or 2% of span	0 ppm to 200 ppm

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

#### 5.0 Results

## **5.1.** Data Capture

Data capture is based on 1 minute data, and refers to the amount of available data collected during the report period.

The percentage of data captured is calculated using the following equation:

Data capture = (Reported air quality data / Total data) x 100%

#### Where:

- Reported air quality data = Number of instrument readings which have been validated through a quality assured process and excludes all data errors, zero data collection due to calibration, failures and planned and unplanned maintenance.
- Total data = Total number of instrument readings since the start of the term assuming no maintenance, errors, loss of data or calibration.

Table 6 below displays data capture statistics for September 2018.

Details of all invalid or missing data affecting data capture are included in the Valid Data Exception Table, see attached Excel file.

**Report No: DAT13724** 

Table 6: Monthly Data Capture for Lane Cove Tunnel & Military Road E-Ramp monitors for September 2018

со				
Monitoring Location	Data Capture (%)			
ACO101	97.5			
ACO102	97.5			
ACO103	91.0			
ACO104	97.5			
ACO401	97.5			
ACO501	97.4			
ACO502	97.4			
ACO503	97.4			
ACO801	97.4			
AQS101	12.7			
AQS102	97.5			
AQS103	97.5			
AQS104	85.6			
AQS105	97.5			
AQS106	-			
AQS107	14.6			
AQS401	97.5			
AQS402	97.5			
AQS403	2.2			
AQS501	12.7			
AQS502	97.4			
AQS503	12.7			
AQS504	97.4			
AQS505	97.4			
AQS506	97.4			
AQS507	97.4			
AQS508	97.4			
AQS801	97.4			

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

# **5.2.** Air Quality Summary

Exceedences of the In Tunnel CO levels observed during the reporting period (if any) are recorded in the table below:

**Table 7: Exceedences Recorded for September 2018** 

Parameter	Time Period	Value of Exceedence	Date of Exceedence	Station
	3 minutes rolling averages	-	-	-
СО	15 minutes rolling averages	-	-	-
	30 minutes rolling averages	-	-	-

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

## **5.3.** Graphic Representations

Validated 1 minute data for CO were used to construct the following monthly graphic representations.

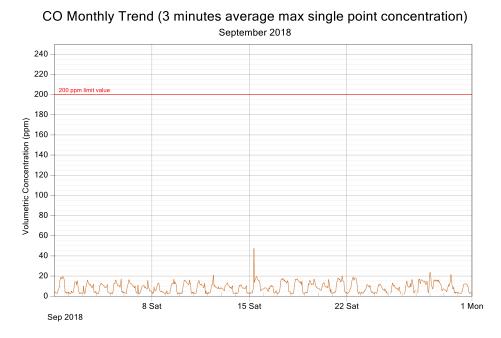


Figure 2: CO exposure and single point 3 minutes rolling averages for September 2018

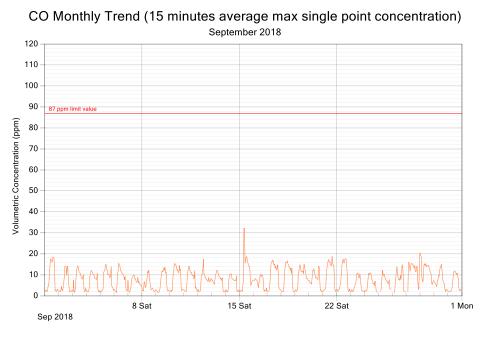


Figure 3: CO exposure and single point 15 minutes rolling averages for September 2018

**Report No: DAT13724** 

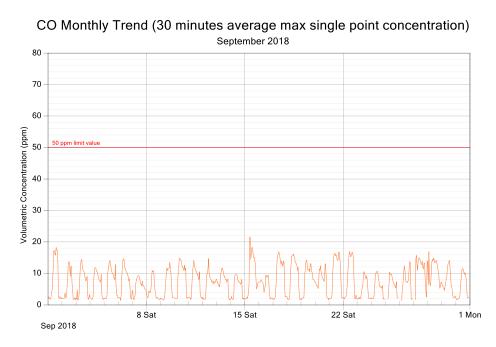


Figure 4: CO exposure and single point 30 minutes rolling averages for September 2018

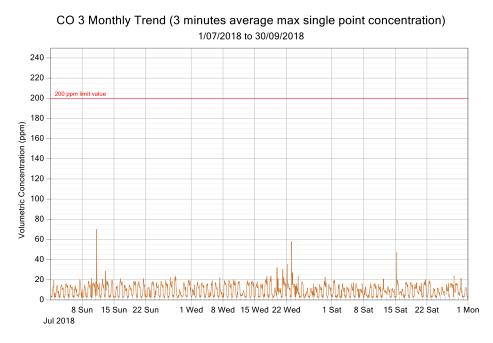


Figure 5: CO exposure and single point 3 minutes rolling averages from July 2018 to September 2018 (3 monthly trend)

**Report No: DAT13724** 

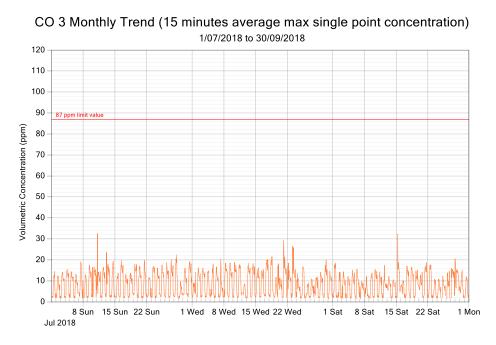


Figure 6: CO exposure and single point 15 minutes rolling averages from July 2018 to September 2018 (3 monthly trend)

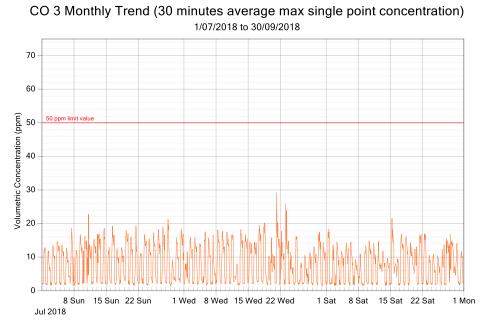


Figure 7: CO exposure and single point 30 minutes rolling averages from July 2018 to September 2018 (3 monthly trend)

# Lane Cove Tunnel & Military Road E-Ramp **Report No: DAT13724 Tollaust Pty Ltd Report Summary** During the reporting period of September 2018, there were no observed exceedances of CO limits stipulated by the Department of Planning inside the tunnel. -----END OF REPORT-----

**Report No: DAT13724** 

**Tollaust Pty Ltd** 

# **Appendix 1 - Definitions & Abbreviations**

CO Carbon monoxide

ppm Parts per million